





4G-AC53U

Wireless-AC750 LTE Modem Router

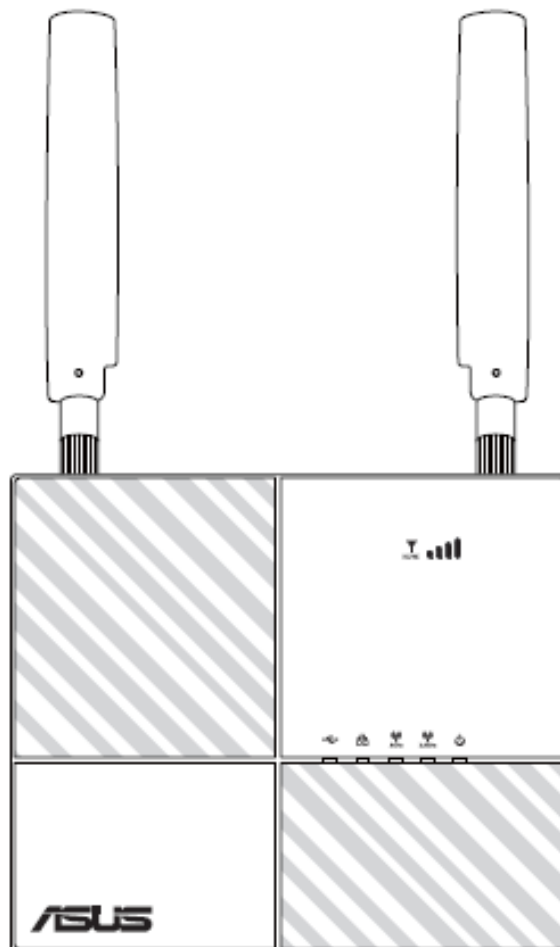

1. Uncompressing the LTE modem firmware package, and there are 3 files in the folder.

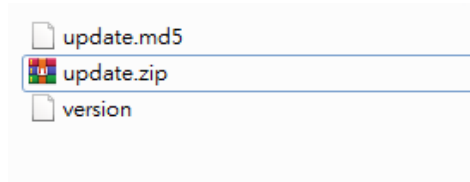

2. Copy these 3 files onto the USB drive in the following path

“/4G-AC53U_LTE”.

3. Insert the USB drive to the USB port of 4G_AC53U, and then open the administration webpage. Once the USB drive is being recognized, go to **WAN** > **Internet Connection** and select Mobile Broadband on "WAN Interface" item, you will see "New software version" shows up.

Mobile Broadband Modem Information	
Modem software version	WWHC052.D61.12.11.001.B
New software version	WWHC052.D61.12.11.102.B Update
IMEI	357858061707063
<i>* Please remove SIM card before starting update and do not remove or unmount USB drive before update process is finished.</i>	
Configure the Mobile Broadband settings of 4G-AC53U.	
SIM PIN Management	
USIM Card Status	<i>SIM card is not inserted.</i>
Apply	

4. **Before performing the firmware update, please make sure the SIM card has been removed.** After SIM card is removed, then click **Update** button to start LTE modem update process.

5. Once the update is completed, the modem software version name will be

changed accordingly.

The screenshot shows the WAN - Mobile Broadband settings page. The left sidebar contains navigation options: General, Network Map, Guest Network, Traffic Manager, Parental Controls, USB Application, AiCloud 2.0, Advanced Settings, Wireless, LAN, WAN (selected), and IPv6. The main content area has tabs for Internet Connection, Dual WAN, Port Trigger, Virtual Server / Port Forwarding, DMZ, DDNS, and NAT Passthrough. The 'WAN - Mobile Broadband' section includes a description of 4G-AC53U connectivity options. Below this is the 'Mobile Broadband Modem Information' table, which shows the current modem software version (WWHC052.D61.12.11.102.B) and the new software version (WWHC052.D61.12.11.102.B) with an 'Update' button. A yellow warning message states: '* Please remove SIM card before starting update and do not remove or unmount USB drive before update process is finished.' Below the warning is the 'SIM PIN Management' section, which shows the USIM Card Status as 'SIM card is not inserted.' and an 'Apply' button.

Mobile Broadband Modem Information	
Modem software version	WWHC052.D61.12.11.102.B
New software version	WWHC052.D61.12.11.102.B Update
IMEI	357858061707105

* Please remove SIM card before starting update and do not remove or unmount USB drive before update process is finished.

SIM PIN Management	
USIM Card Status	SIM card is not inserted.

[Apply](#)